

SMB Right Angle Cable Plug **Crimp Attachment** 1060231-1

Instruction Sheet 408-4724 08 FEB 00 Rev O EC 0990-0122-00

CONNECTOR TYPE

CABLE PLUG


CRIMP ATTACHMENT

 
TYPE SMB RIGHT ANGLE RG-178/U

CABLE

TOOLS REQ'D LOCATOR TOOL: 5098-5031-02


CRIMP TOOL: 2598-5005-54 DIE NO. A

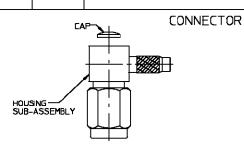



ASSEMBLY OPERATIONS


- 1.0 PREPARE COAXIAL CABLE END
- 1.1 PLACE FERRULE ON CABLE.
 1.2 REMOVE END PORTION OF CABLE JACKET AND TRIM CABLE TO DIMENSIONS SHOWN.
- 1.3 FLARE OUTER CONDUCTOR.
 1.4 CUT TWO SLITS IN CABLE JACKET AS SHOWN (OPTIONAL).

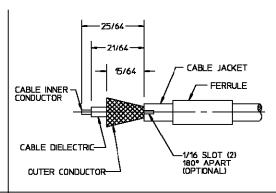

- 2.0 <u>SOLDERING OF CABLE INNER CONDUCTOR</u>
 TO HOUSING SUB-ASSEMBLY
- 2.1 SECURE LOCATOR TOOL TO HOUSING
- SECURE LOCATOR TOOL TO HOUSING SUB-ASSEMBLY.
 POSITION AND SECURE HOUSING SUB-ASSEMBLY IN A SMALL BENCH VISE.
 TIN INNER CONDUCTOR OF CABLE.
 INSERT CABLE INTO HOUSING
 SUB-ASSEMBLY AND NEST INNER
 CONDUCTOR IN CONTACT SLOT.
 PLACE SOLDERING IRON ON TIP DE
- CONTACT AND SOLDER.
- 3.0 CRIMP CABLE TO HOUSING SUB-ASSEMBLY
- 3.1 SLIDE FERRULE OVER FLARED PORTION OF OUTER CONDUCTOR.

 3.2 CRIMP FERRULE IN PLACE.

 3.3 TRIM AND REMOVE EXCESS OUTER CONDUCTOR STRANDS.

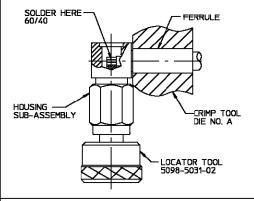

- 4.0 SEAL OPENING IN HOUSING
- 3.1 STAKE METAL CAP INTO PLACE.

