


AMPMODU * HEADER ASSEMBLIES (With MOD I Posts)

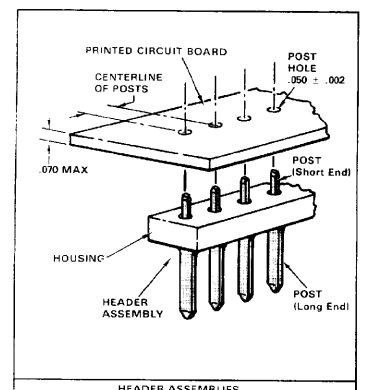



POST CENTERLINE SPACING				
.156		.200	.250	.312
85829 85830 85839 85840 85875 85923 86207 86469 87113 87119 87160	87262 87247 87283 87403 87633 87761 87762 87808 87943 87956	86416 87183 87397	87064	86137 86199 86247 86359 87852

Fig. 1

1. INTRODUCTION

This instruction sheet covers the recommended procedures for clinching AMPMODU Header Assemblies (with MOD I posts) onto printed circuit (pc) boards. The assemblies listed in Figure 1 are designed for machine clinching in production line applications or for manual clinching in low volume applications. Read this material thoroughly before clinching header assemblies onto pc boards.

NOTE.

All dimensions presented on this instruction sheet are in inches, unless otherwise stated.

2. DESCRIPTION (see Figure 1)

Header assemblies are available with various numbers of in-line post positions, various post lengths, and various post center-to-center spacing dimensions.

TRADEMARK OF AMP INCORPORATED

Each header assembly consists of a housing preloaded with .031 x .062-in, posts.


3. PRINTED CIRCUIT BOARD LAYOUT

Determine the post centerline spacing and number of post positions in the header assembly to be mounted. Prepare the pc board using the dimensions provided in Figure 1.

4. CLINCHING PROCEDURES

A. Machine Clinching

A standard arbor press, a holding fixture, and a clinching tool are required to perform production line applications. The holding fixture supports the header assembly and pc board in the press base. The clinching tool bends the post to retain the header assembly on the pc board. Refer to the recommended dimensions provided in Figure 2 for construction of a holding fixture and a clinching tool.

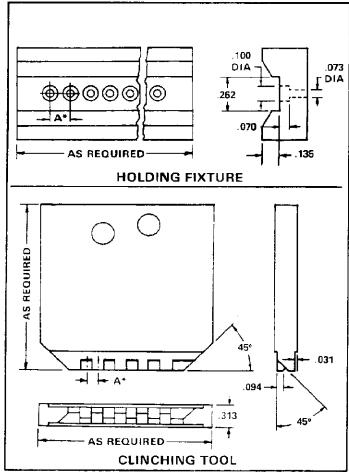

*DETERMINED BY POST CENTERLINE SPACING - SEE CHART IN FIGURE 1.

Fig. 2

Refer to Figure 3 and proceed as follows:

- Secure clinching tool to press ram.
- 2. Position holding fixture on press base. Make certain holding fixture holes are centered under clinching tool surfaces.
- Insert header assembly posts (long ends) into holding fixture holes. Bottom housing on fixture.
- 4. Align pc board holes with posts (short ends). Press board down on posts until it seats on fixture.


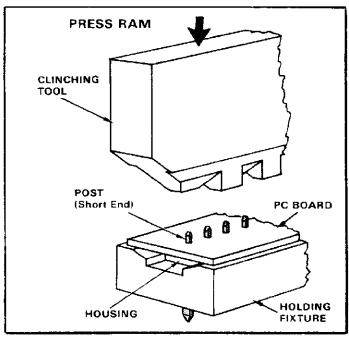


Fig. 3

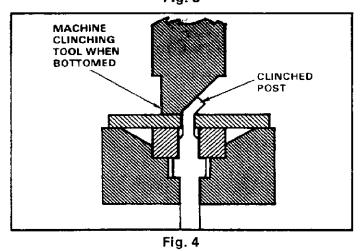

- 5. Actuate press until clinching tool bottoms on pc board. Release pressure and remove clinched assembly from holding fixture. Check to be sure all posts are properly clinched (ser Figure 4).
- 6. After all posts are clinched, they should be soldered to the pc board.

B. Manual Clinching

A support fixture and a common screwdriver are required to perform low volume applications. Make sure support fixture height is greater than post length.

Refer to Figure 5 and proceed as follows:

- 1. Insert header assembly posts (long ends) between support fixture and allow housing to rest on fixture.
- 2. Align pc board holes with posts (short ends). Press board down on posts until it bottoms on housing.
- 3. Position screwdriver tip at an angle between two posts. Keeping blade parallel to poboard, raise screwdriver slightly above board. Rotate screwdriver until posts are clinched.
- 4. Repeat Step 3 until all posts are clinched.

NOTE

The direction of bend must be alternated so that posts will retain pc board.

5. After all posts are clinched, they should be soldered to the pc board.

