

PROPER USE GUIDELINES

Cumulative Trauma Disorders can result from the prolonged use of manually powered hand tools. AMP hand tools are intended for occasional use and low volume applications. AMP offers a wide selection of powered application equipment for extended-use, production operations.



Figure 1

1. INTRODUCTION

This instruction sheet covers the description, cable requirements, and installation procedures for AMP Connector–Specific Kit 768350–1, which is used with AMP–LATCH Hand Tool Kit 768340–1 (see instruction sheet 408–9828) and Base Assembly Universal Arbor Tool 768338–1 (see 408–9827). The connector– specific kit will terminate AMP–LATCH 50–Position HDF Connectors having 1.27 mm [.050 in.] centerline spacing to ribbon cable (see Figure 2).

cad



The Base Assembly Universal Arbor Tool is used with AMP Manual Arbor Frame Assembly 91085-2 and AMP Pneumatic Auto-Cycle Unit 91112-3. Refer to 408-7777 and 408-6732, respectively, for tooling information.

Dimensions on this sheet are in metric units [with U.S. customary equivalents in brackets].

2. DESCRIPTION (Figure 1)

The connector-specific kit features an upper tool, an adaptor, and a lower insert. The upper tool and the adaptor apply an even force over the length of the connector during termination. The lower insert positions the connector on the tooling assembly. Each component is marked "AMP HDF 50."

3. CABLE REQUIREMENTS

The connector-specific kit will terminate ribbon cable with 26 AWG solid or stranded conductors, 28 AWG solid or stranded conductors, or 30 AWG solid conductors to all AMP-LATCH 50-position HDF Connectors. Refer to Figure 2 for the recommended cable dimensions.



NOTE

ACCUMULATIVE TOLERANCE FOR CABLE CONDUCTORS 1 THROUGH 34 IS + .254 [.010] AND THROUGH 60 IS + .38 [.015].

CONDUCTOR		DIMENSION	
SIZE (AWG)	TYPE	" A "	" B "
26	Stranded or Solid	0.889 mm	1.27 mm [.050 IN.] X (Total No. of Conductors Minus One)
28	Stranded or Solid		
30	Solid		

Figure 2

CAUTION

The cable must be cut 90° to the edge of the cable; otherwise an improper termination will result. We suggest you use a guillotine-type cable cutter, such as the Carpenter Model 95 which can be purchased from:

Carpenter Manufacturing Co., Inc. Fairgrounds Drive Manlius, N.Y. 13207

AMP-LATCH HAND TOOL KIT 768340-1 (Ref) (Includes AMP-LATCH Hand Tool Subassembly 768942-1 and Base Assembly Universal Hand Tool 768339-1. Refer to 408-9846 and 408-9826)



Figure 3

4. CONNECTOR-SPECIFIC KIT INSTALLATION (Figures 3 and 4)

- For hand tool applications, mount the hand tool onto a suitable work surface, whenever possible, before terminating the connectors. Refer to the bench-clamping instructions in 408-9828, packaged with the AMP-LATCH Hand Tool Kit.
- 1. Slide the upper tool onto the upper tool mount.

2. Slide the lower insert into the slot of the fluted plate.

Place the adaptor into the plug connector prior to termination.



When using the hand tool, the upper tool is not used.

NOTE

cad 9831

NOTE

The adaptor is not needed when terminating receptacle connectors.

This completes the installation procedure.





Figure	5
riguie	υ

Adaptor

768938-1

Rev A

3

cad

1