

CONNECTOR



CONNECTOR TYPE

OSM STRAIGHT CABLE JACK DIRECT SOLDER ATTACHMENT


CABLE TYPE

.141 SR COAXIAL CABLE


TOOLS REQUIRED:

FIXTURE BASE: 2098-5206-54 (T-4567) CLAMP INSERT: 2098-5207-54 (T-4700-1) CENTER CONTACT HOLDER: 2098-5221-10 (T-4578) SOLDER GAGE: 2098-5516-02 (T-4562-5) DIE INSERT TOOL: 2098-5215-02 (T-4559) LOCATOR TOOL: 2098-5210-02 (T-4569)

- 1.0 PREPARATION OF CABLE.
 - 1.1 INSERT SQUARED CABLE END INTO FIXTURE BASE HOLE PATTERN #2.
 - 1.2 PLACE SAW IN SAW SLOT AND CUT THROUGH OUTER CONDUCTOR AND INTO DIELECTRIC WHILE ROTATING CABLE.
 - 1.3 REMOVE CABLE FROM FIXTURE AND FINISH
 CUTTING DIELECTRIC WITH CUTTING
 RIADE
 - 1.4 BARE INNER CONDUCTOR BY PRYING CUT
 OUTER CONDUCTOR AND DIELECTRIC FROM
 CABLE.
 - 1.5 TRIM CABLE INNER CONDUCTOR TO LENGTH.

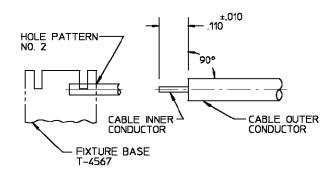


- 2.0 SOLDERING OF CENTER CONTACT TO CABLE INNER CONDUCTOR
 - 2.1 TIN INNER CONDUCTOR OF CABLE.
 - 2.2 PLACE SOLDER GAGE ON INNER CONDUCTOR, FLUSH WITH END OF OUTER CONDUCTOR.
 - 2.3 PLACE CENTER CONTACT IN HOLDER, HEAT CENTER CONTACT AND PUSH IT OVER INNER CONDUCTOR OF CABLE TO REST FIRMLY AGAINST SOLDER GAGE.
 - 2.4 REMOVE SOLDER GAGE AND EXCESS SOLDER.

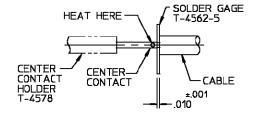


- 3.0 SOLDERING OF CABLE SUB-ASSEMBLY TO HOUSING SUB-ASSEMBLY.
 - 3.1 PLACE CONNECTOR HOUSING ON END OF CABLE SUB-ASSEMBLY.
 - 3.2 PLACE LOOSE ASSEMBLY IN FIXTURE BASE AS SHOWN.
 - 3.2.1 NEST CENTER CONTACT IN LOCATOR TOOL.
 - 3.2.2 TIGHTEN CLAMP SCREW TO SECURE CABLE.
 - 3.2.3 TIGHTEN LOCATOR TOOL TO SEAT CABLE FIRMLY.
 - 3.3 SLIDE HOUSING OVER LOCATOR TOOL.
 - 3.4 MAINTAIN POSITION OF HOUSING FIRMLY AGAINST LOCATOR TOOL AND SOLDER.

NOTE: FIXTURE SHOULD BE CLAMPED VERTICALLY
TO KEEP HOUSING SEATED AGAINST
LOCATOR TOOL.

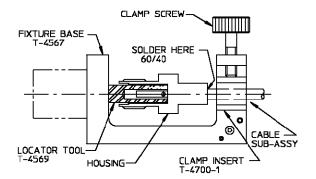



- 4.0 PRESSING OF DIELECTRIC INTO HOUSING SUB-ASSEMBLY
 - 4.1 THREAD INSERT TOOL INTO HOUSING SUB-ASSEMBLY
 4.2 INSERT DIELECTRIC INTO INSERT TOOL
 - HOUSING.
 - PLACE INSERT TOOL PLUNGER INTO POSITION AND PRESS UNTIL FLANGE BOTTOMS ON TOOL HOUSING ASSEMBLY IS NOW COMPLETE. 4.3

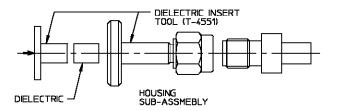

NOTES:

INTERFACE DIMENSIONS PER MIL-STD-384A-310-1

2 of 2 Rev A