APPLICATION SPECIFICATION

1. SCOPE

This specification covers the requirements for application of AMPLIVAR* subminiature thru splices. These requirements are applicable to automatic machine crimping tools. For specific CMA (circular mil area) ranges relative to the products covered in this specification, see Figure 4.

2. NOMENCLATURE

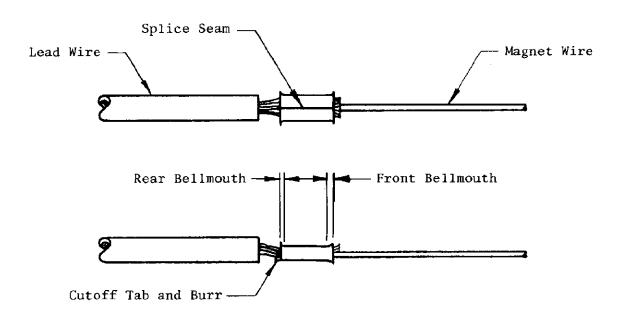


Figure 1

3. CRIMP AND DIMENSIONAL REQUIREMENTS

3.1. Wire Preparation

A. Magnet Wire

No preparation required.

B. Lead Wire


- (1) Insulation shall be stripped as indicated in Figure 4.
- (2) Reasonable care shall be taken not to nick, scrape or cut any strands or the solid wire during the stripping operation.

8 2 4	*Trademark of AMP Incorporated.										
O IKJ			<u> </u>		C. E. Fint	6/9/75	TA AA	AMP IN	CORPORATE		
:			CHK 5-24-75 C. MEYERS					Harrisburg, Pa.			
	<u> </u>				APP	6/1/15	Loc A	Nº114 - 2	2005	REV	
-					C.G. Key	NAME	D A				
DIST				-	SHEET	SPLICE, THRU, SUBMINIATURE,					
02	A	Revise Figure 3	ADE	415/83	1 OF <u>3</u>	AMPLIV	VAR, AI	PPLICATION	OF		
_ ~_	LIK	REVISION RECORD	APP	DATE							

3.2. Carrier Cutoff Tab and Burr

A. Cutoff Tab

- (1) Cutoff tab shall not exceed .010.
- (2) Cutoff tab shall be centered within the limits shown in Figure 2.



Cutoff tab centered with centerline of splice within .015.TIR.

Figure 2

B. Burr

Burr on cutoff shall not exceed .008.

3.3. Splice Crimp

A. Crimp Dimensions

- (1) Crimp width shall be as shown in Figure 4.
- (2) Consult AMP Engineering for specific crimp heights. Crimp heights specified by AMP Engineering shall be measured at the location shown in Figure 3, with a tolerance of $\pm .002$ unless otherwise specified.


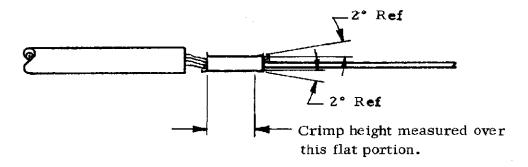


Figure 3

B. Tensile Strength

Crimp tensile strength shall be 70% of the wire tensile strength.

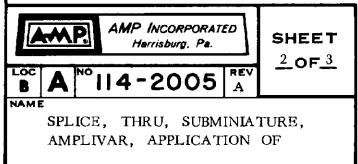

C. Splice Seam

Splice seam shall be completely closed and there shall be no evidence of loose wire strands or wire strands visible in the seam.

D. Bellmouth


Bellmouth permissible both ends.

E. Conductor Location

- (1) Stranded and magnet wires must extend thru crimped splice.
- (2) Conductors shall be visible between the lead wire insulation and the rear of the splice.
- (3) Magnet wire(s) shall lie in the bottom of the splice.

Part	Wire	Lead Wire	Splice Crimp		
Number	CMA	Strip Length	Width	Туре	
62194	400-1600	.150 ± .031	.070	F	

Figure 4



SPLICE, THRU, SUBMINIATURE, AMPLIVAR, APPLICATION OF