



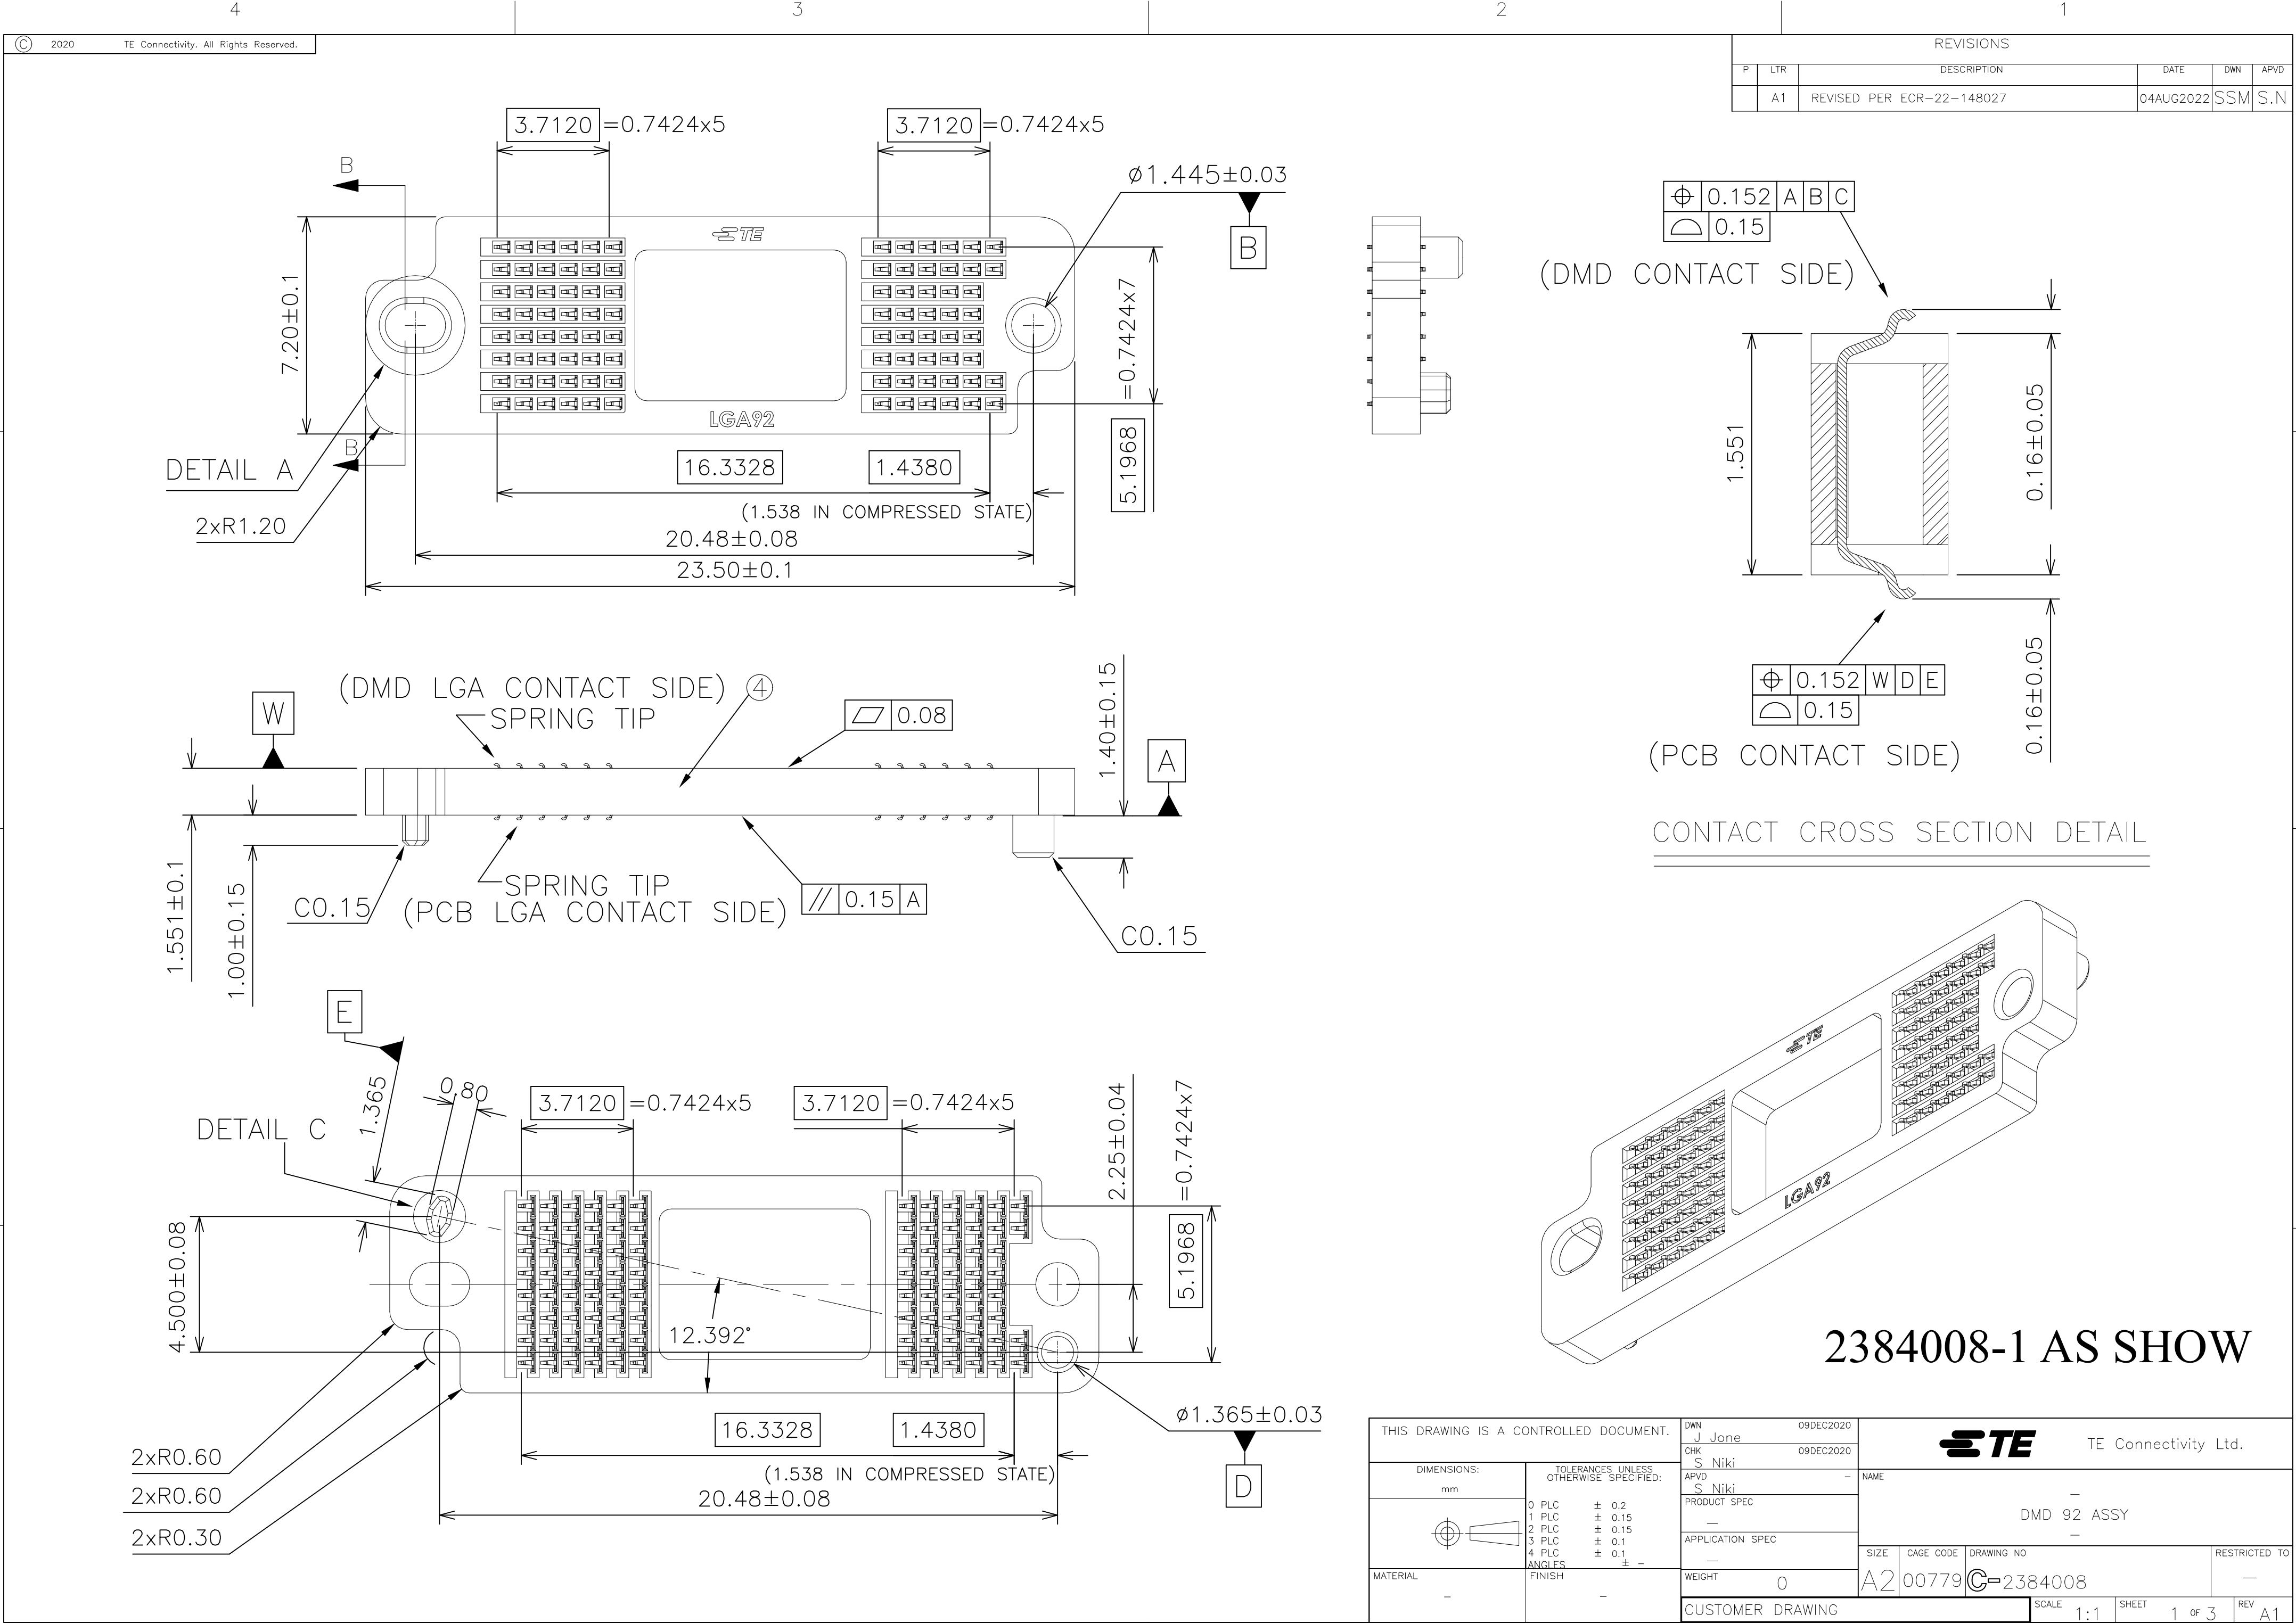

REVISIONS					
P	LTR	DESCRIPTION	DATE	DWN	APVD
A1		REVISED PER ECR-22-148027	04AUG2022	SSM	S.N

ϕ	0.152	A	B	C
$\frac{1}{2}$	0.15			


(DMD CONTACT SIDE)

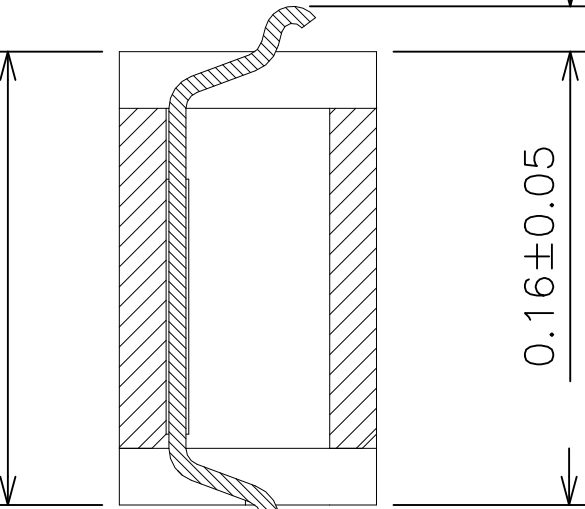


ϕ	0.152	W	D	E
$\frac{1}{2}$	0.15			

(PCB CONTACT SIDE)





CONTACT CROSS SECTION DETAIL

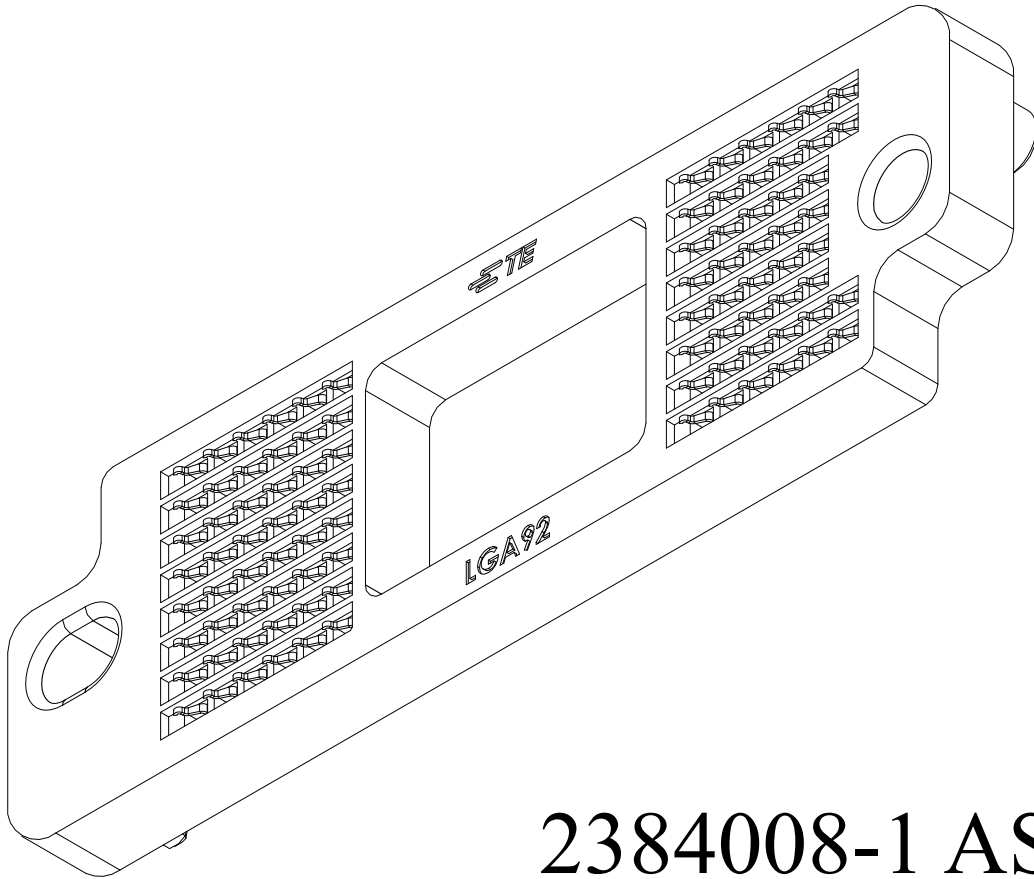

2384008-1 AS SHOW

THIS DRAWING IS A CONTROLLED DOCUMENT.		DWN J. Jone 09DEC2020	 TE Connectivity Ltd.			
DIMENSIONS: mm		CHK S. Niki 09DEC2020				
		APVD S. Niki PRODUCT SPEC	NAME DMD 92 ASSY			
TOLERANCES, UNLESS OTHERWISE SPECIFIED:		APPLICATION SPEC	SIZE A2			
MATERIAL		WEIGHT 0	CAGE CODE 00779		DRAWING NO C=2384008	
FINISH		CUSTOMER DRAWING	SCALE 1:1		SHEET 1 OF 3	
					REV A1	


REVISIONS					
P	LTR	DESCRIPTION	DATE	DWN	APVD
	-	SEE SHEET 1	-	-	-

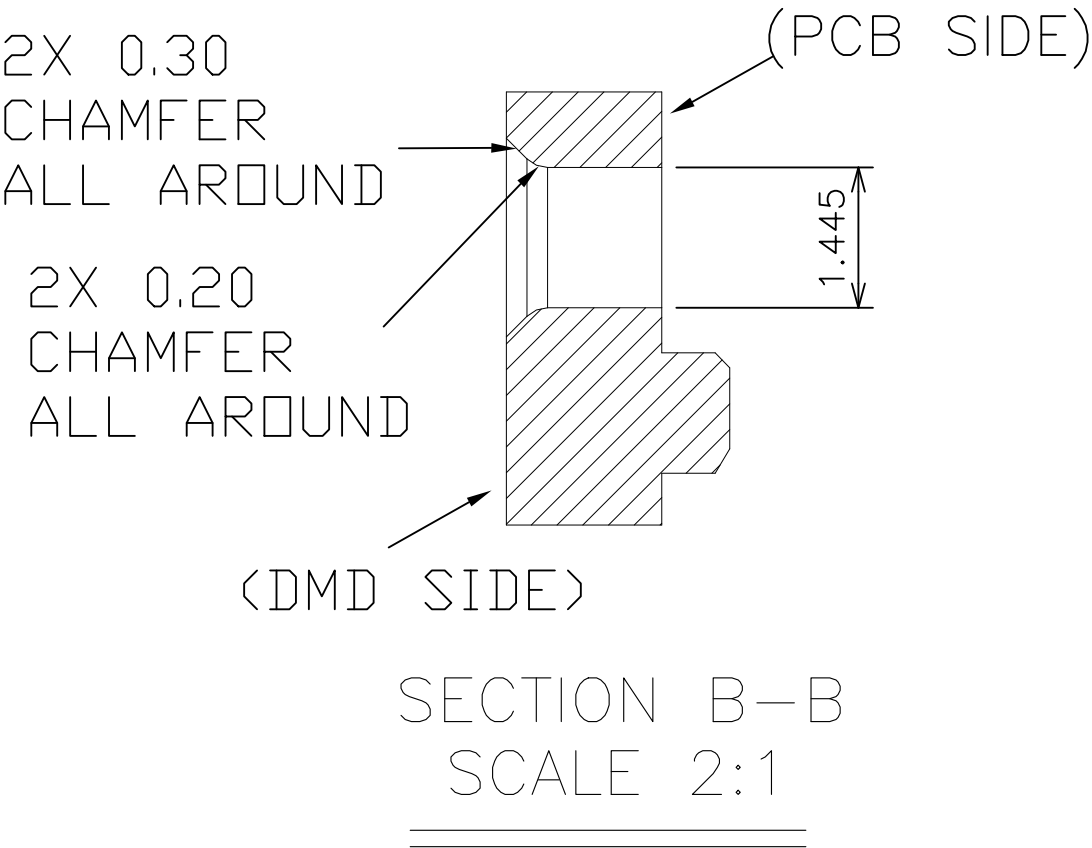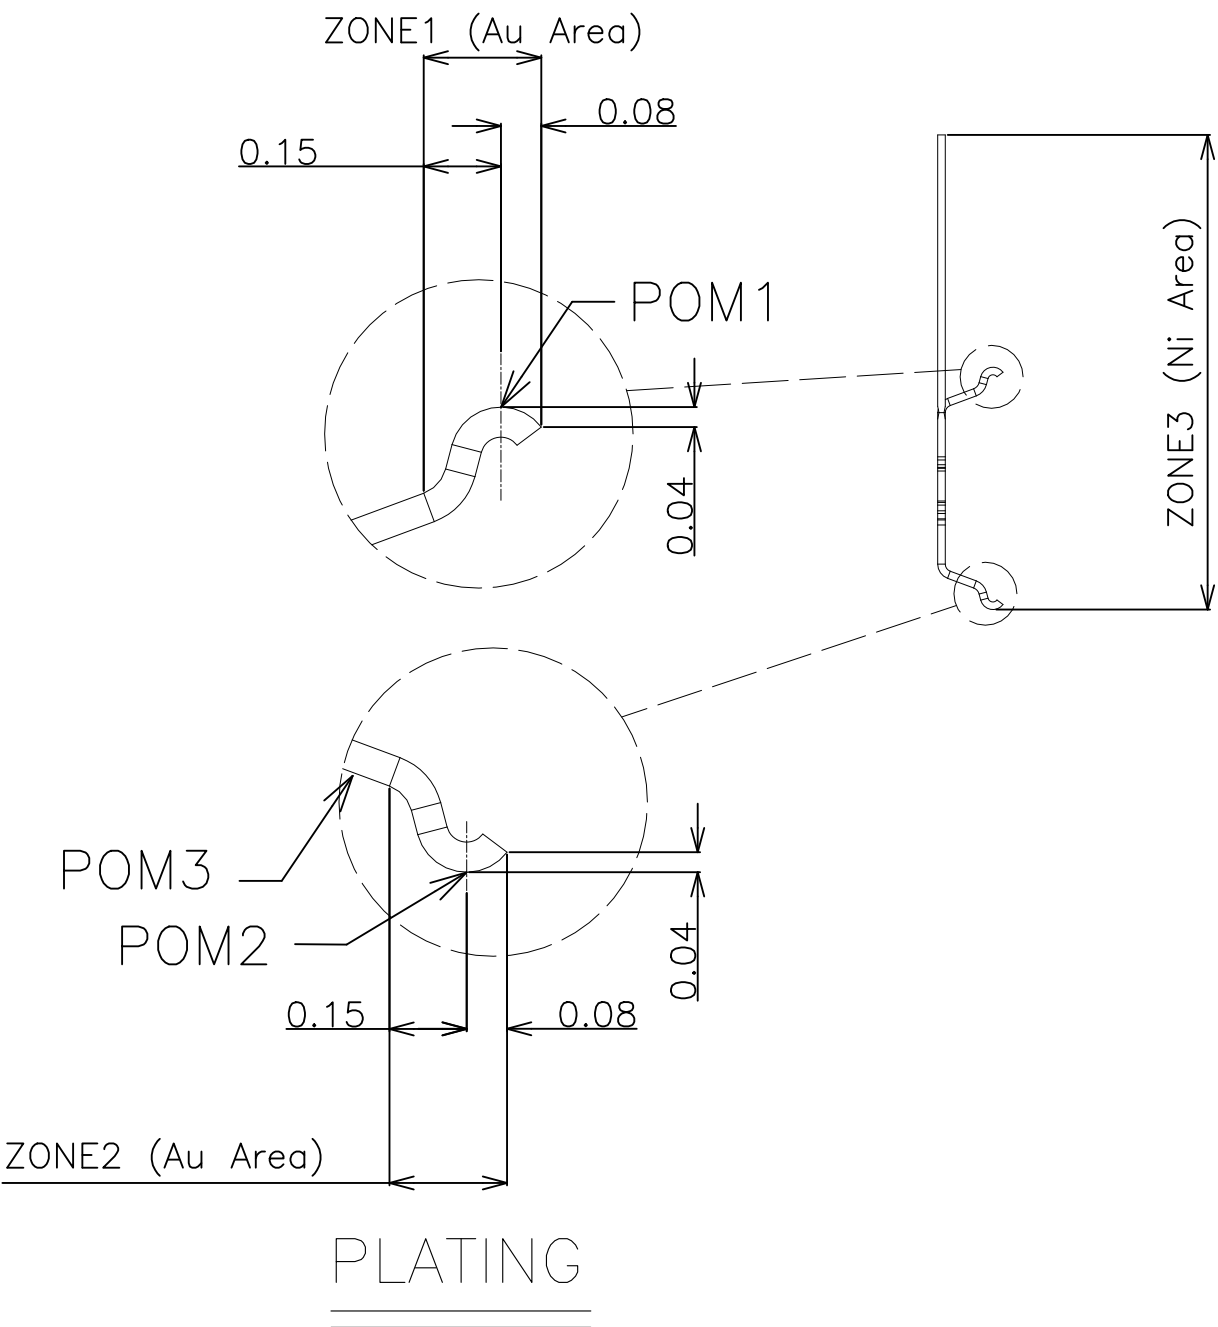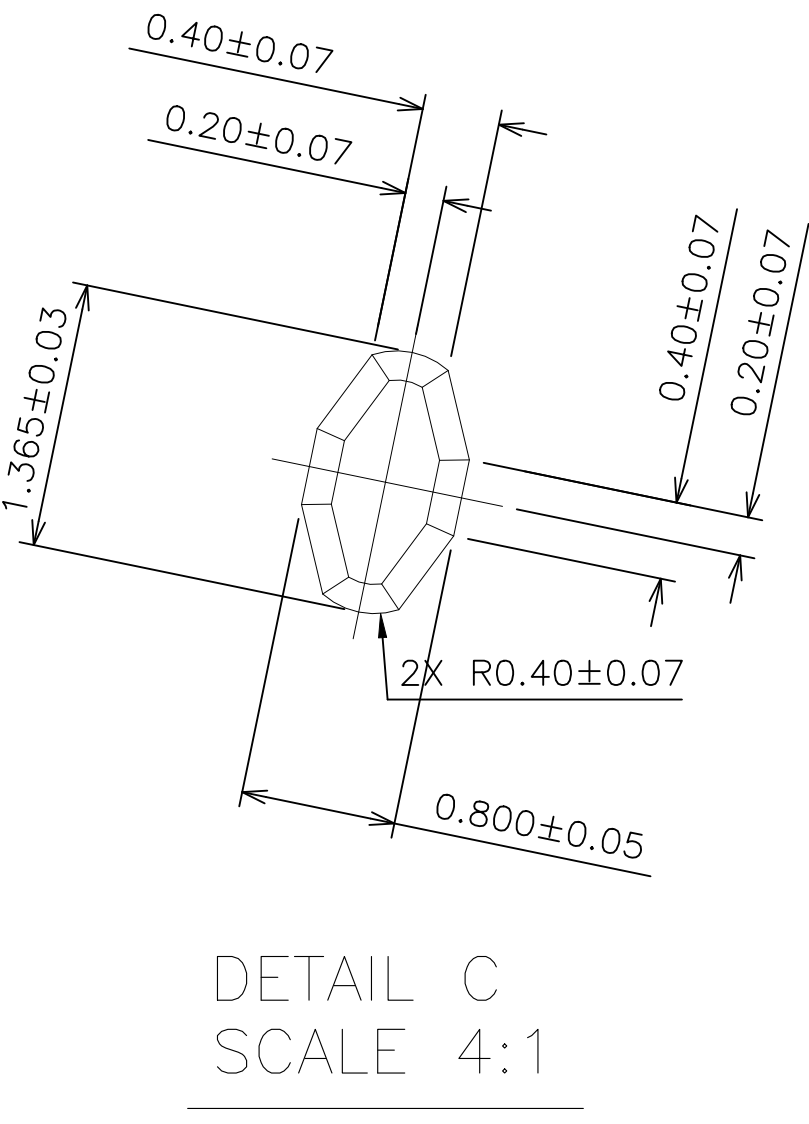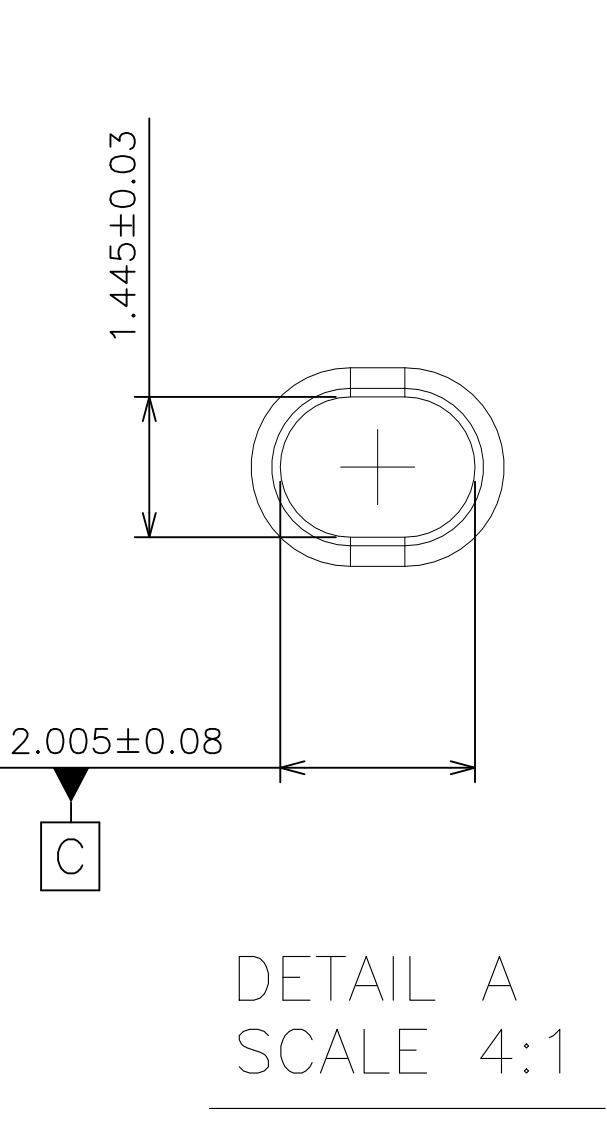


- NOTES:
PRODUCT MUST MEET CONTROLLED SUBSTANCES SPEC. ROHS 2.0
1.MATERIAL:
HOUSING: LCP, UL94V-0, COLOR: BLACK.
CONTACT:COPPER ALLOY.
PLATING:3u” MIN Au ON CONTACT AREA
60u”MIN Ni OVERALL.
2.THICKNESS: 1.60MM AFTER COMPRESSION.
3.RECOMMENDED CONNECTOR LOADING FORCE:2.2KGF MIN;12KGF MAX.
④DATECODE POSITION.
5.NO ROUND AT THE HOUSING BOTTOM OF TWO POS.

THIS DRAWING IS A CONTROLLED DOCUMENT.		DWN	09DEC2020	TE Connectivity Ltd.	
		CHK	-		
DIMENSIONS:		APVD	-	NAME	
mm		PRODUCT SPEC		DMD 92 ASSY	
		APPLICATION SPEC		SIZE	CAGE CODE
				A2	00779
		WEIGHT		DRAWING NO	RESTRICTED TO
		CUSTOMER DRAWING		C=2384008	-
MATERIAL		FINISH		SCALE	SHEET
				1:1	2 OF 3
				REV	A1


REVISIONS					
P	LTR	DESCRIPTION	DATE	DWN	APVD
	-	SEE SHEET 1	-	-	-

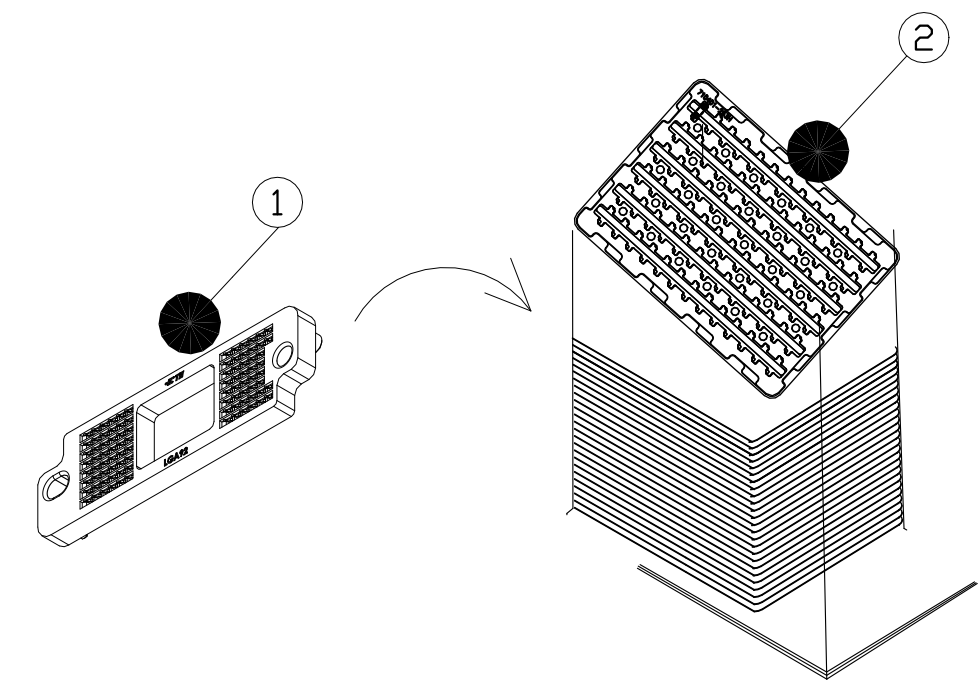


Step1.
Put the products into tray with direction as the left sketch shown, 78pcs/tray. round hole facing the tray P/N.
16 trays stacked up per bundle.
Then add an empty tray on topside.

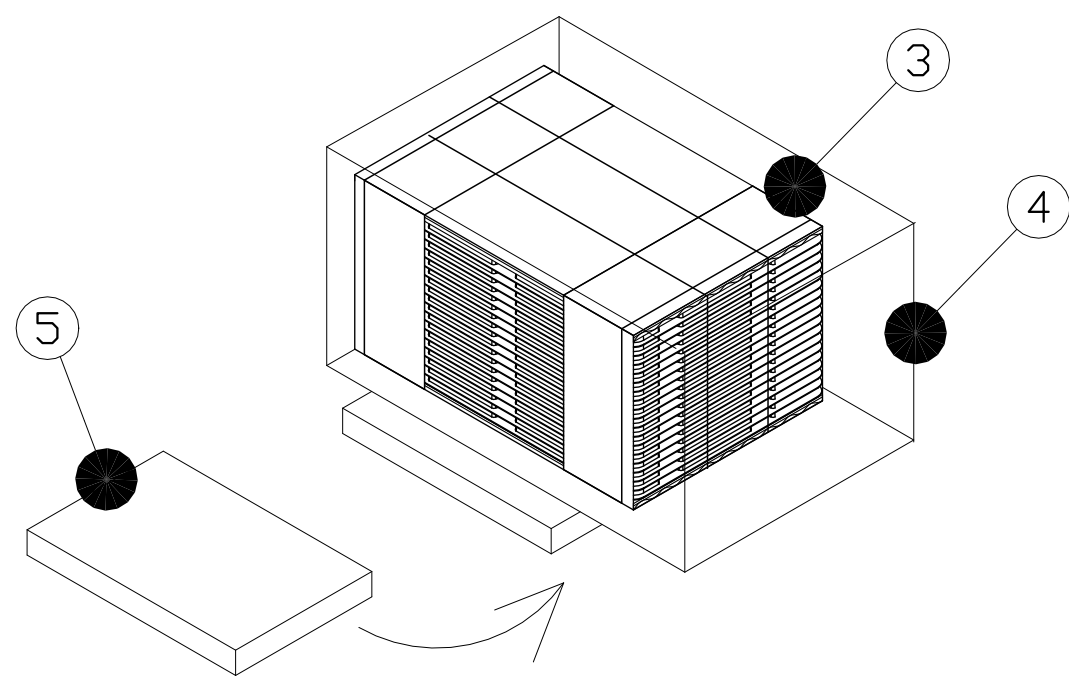

Step2.
Put a piece of foam in the bottom center to prevent defomation after the PE film winding and vacuum package.

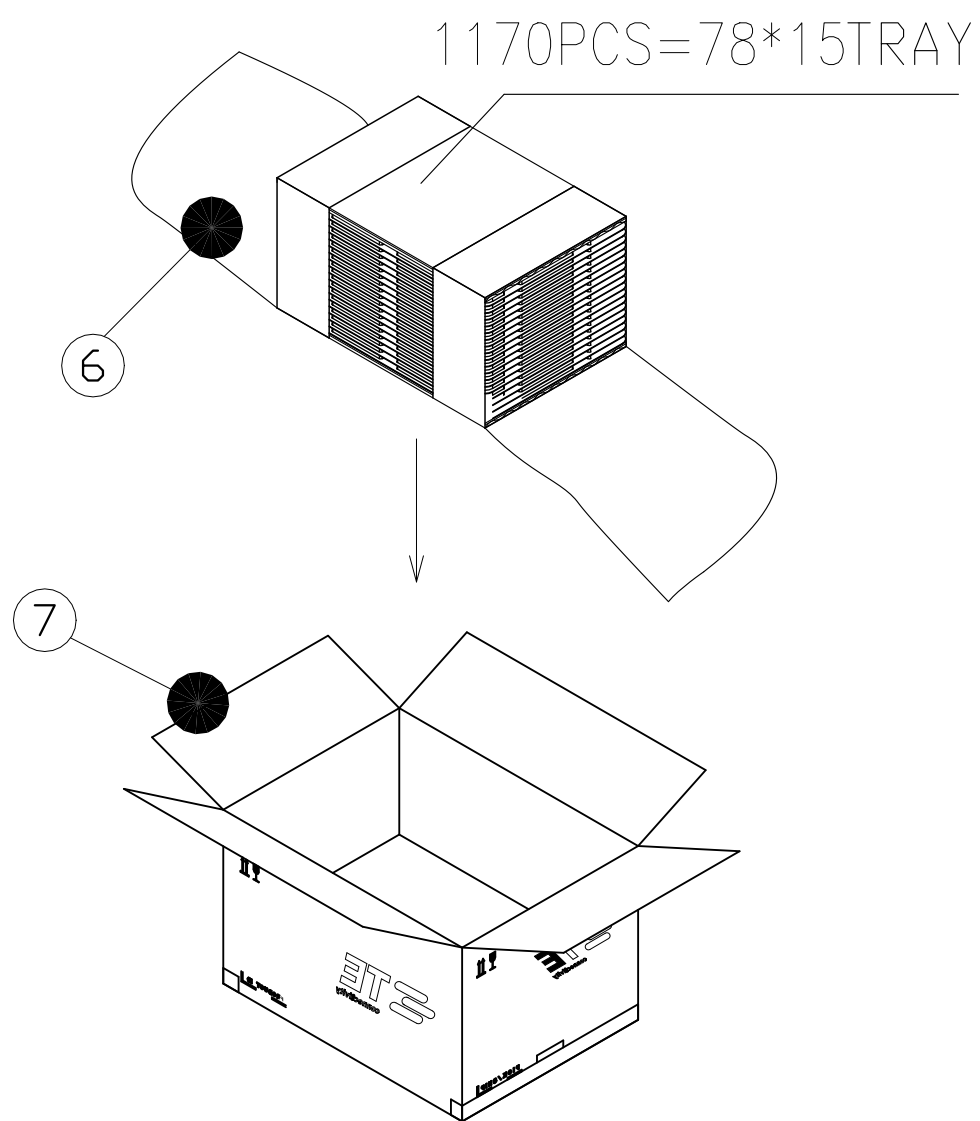


Step3.
Place the foam in the carton, put the products bundled into carton

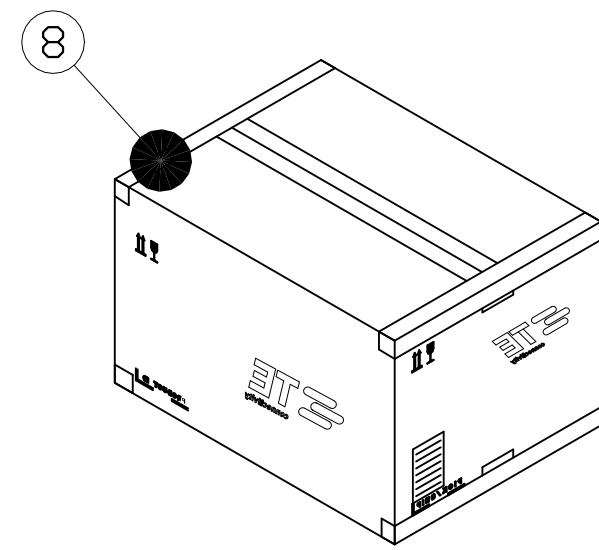

Step4.
Seal outer carton with packing tape like a 'H' shape

- NOTE:
1. Put the products into tray with direction as the left sketch shown, 78pcs/tray. round hole facing the tray P/N
16 trays stacked up per bundle.
Then add an empty tray on topside.
 2. Put a piece of foam in the bottom center to prevent defomation after the PE film winding and vacuum package
 3. Place the foam in the carton, put the products bundled into carton
 4. Seal outer carton with packing tape like a 'H' shape
 5. Packaging quantity: 1170pcs/ carton.

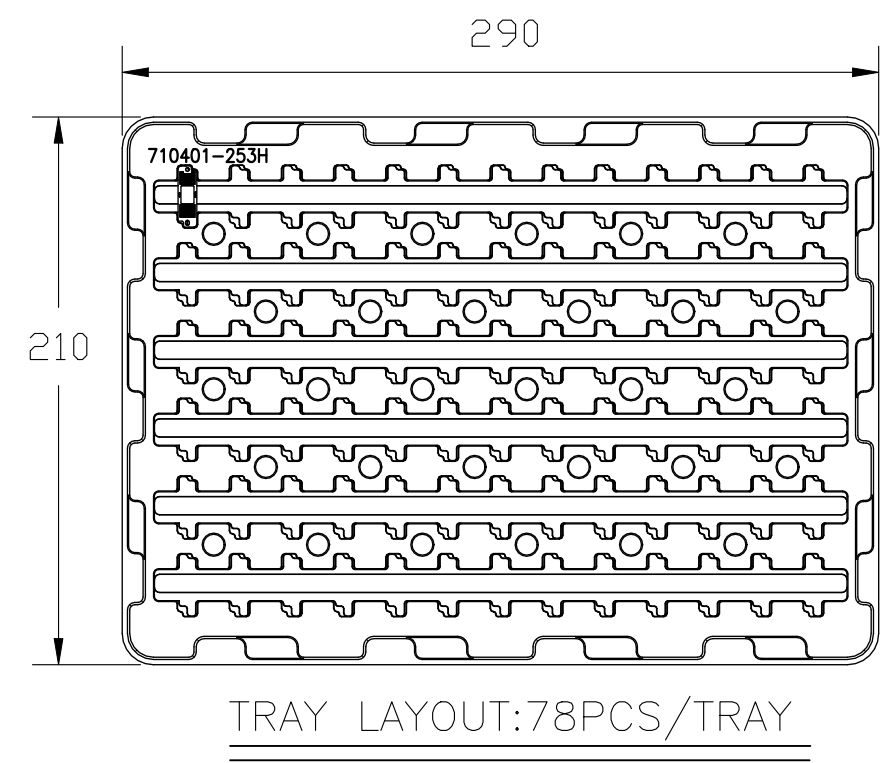

8	PACKING TAPE	-	-
7	CARTON	240*315*150MM(INNER)	1/1170
6	BUBBLE WRAP	330MM(W)*8MM(T)	2140MM
5	FOAM	307x130x10MM	1/1170
4	PE BAG	550*350*0.16MM	1/1170
3	PE FILM	-	-
2	TRAY	290*210MM	16/1170
1	Product	-	1
NO.	PART NAME	SPEC.	QTY

THIS DRAWING IS A CONTROLLED DOCUMENT.

DIMENSIONS:
mm

MATERIAL
-

TOLERANCES, UNLESS OTHERWISE SPECIFIED:

0 PLC	±
1 PLC	±
2 PLC	±
3 PLC	±
4 PLC	±
ANGLES	±
FINISH	-

DWN
09DEC2020

CHK
-

APVD
-

PRODUCT SPEC
-

APPLICATION SPEC
-

WEIGHT
-

CUSTOMER DRAWING

TE Connectivity Ltd.

NAME
DMD 92 ASSY

SIZE A2	CAGE CODE 00779	DRAWING NO C=2384008	RESTRICTED TO -
------------	--------------------	-------------------------	--------------------

SCALE 1:1	SHEET 3 of 3	REV A1
--------------	-----------------	-----------